

febiEXAKT



Timing chain kit

febi no. 40672

Repl. no. 03C 109 158 A S1

to fit

Seat Altea, Altea XL

Škoda Octavia

VW Golf PLUS, Golf V, Passat Variant and more



>> PROBLEM:

Problems with the timing chain in vehicles with 1.4 TSI engines.

>> CAUSE:

The series manufacturer has reported quality problems with the individual components. Worn tools used during production have left behind metal burrs on the chain links. This leads to premature wear on the chain.

>> SOLUTION:

Make sure that you have installed the latest version of the camshaft adjusters. The manufacturer has replaced the camshaft adjusters which have the OE number 03C 109 088 E. The manufacturer explicitly states that the new version must be installed.

>> ATTENTION:

Afterwards, carry out a system update of the engine control unit to ensure that the engine runs properly!

Register now for the official febi bilstein newsletter and receive the latest technical information automatically by email!


Further information may be obtained at: www.febi.com



New Version
OE-Number 03C 109 088 E



Chain tensioner febi 36484

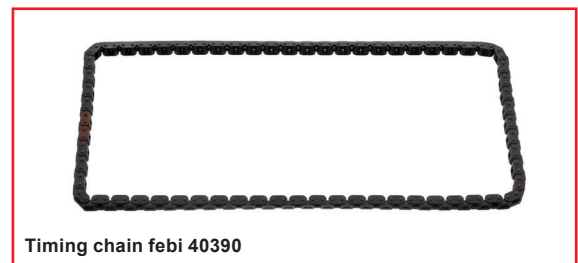

Timing chain febi 40390