

# Technical *data*

CT 939 K2/K3 & CT1120K1 timing belt kit, used for example in:  
VW / Audi 2.5 TDI 5 cyl.

## Problem:

In accordance with the updated equipment status, the timing belt kit contains a thin washer (diamond-coated) that was not previously installed in the vehicle.

## Solution:

According to the VW/Audi catalog, this special washer (4) is to be installed between the crankshaft drive wheel (3) and the torsional vibration damper (5). This is intended to improve the co-efficient of friction.

Fig. 1  
Washer

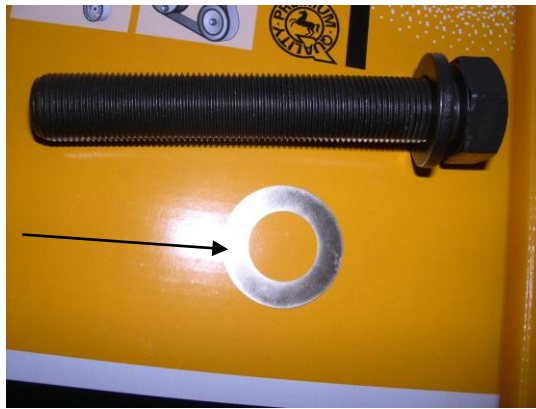


Fig. 2  
Installed position

