


**to fit:**

Renault 1.6 16V

Engine: K4M

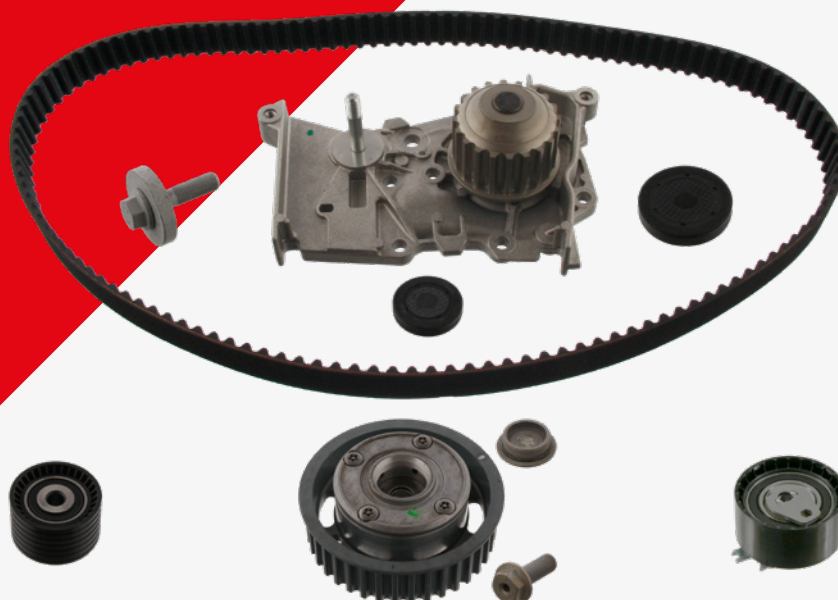

EN

Timing Belt Kit with Water Pump

Problem

Intermittent starting and a rattling noise coming from the top of the engine when first started.

Cause

Internal failure of the camshaft gear/dephaser pulley – this controls the adjustment of the variable valve timing.

Solution

Replace the variable camshaft timing pulley (febi 36415). It is also recommended that during the replacement of this pulley, the complete timing belt kit – including the water pump (febi 36444) – should also be replaced for a complete repair.

For more technical information please visit: partsfinder.bilsteingroup.com